



PEUGEOT 5008: FQ-328-RP

Vinnumber:	VF3MCYHZRLS136739	Versionname:	PEUGEOT 5008 BlueHDi 130 S&S EAT8 ALLURE VP [5P] bva 8-130CH-6cv (SUV)
First Registrationdate:	19/06/2020	Fiscalpower:	
Expertise Mileage:	196851	Power Kw:	96
Bodytype:	SUV	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Tow bar	
Number keys remote	2	Radio	
GPS big screen color		Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Rear view camera	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			Lining Leather
Type of climate control	Autom climate control		

Tyres

	225/55/18/102 V			
Summer tyres:	Fr.L.	Firestone: 25%	Fr.R.	Firestone: 25%
	Re.L.	Firestone: 45%	Re.R.	Firestone: 25%
Tyre profile depth FL				6.6
Tyre profile depth FR				6.4
Tyre profile depth RL				5.4
Tyre profile depth RR				6.5
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				258
Tyre make FR				258
Tyre make RL				258
Tyre make RR				258

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Seat cover FL, Tear, Replace			




Outer backrest protection R, Scratch(es), Replace




Inner door sill RR, Scratch(es), Acceptable



Roof liner, Stain, Cleaning

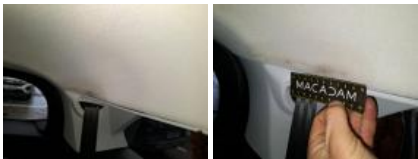

Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)

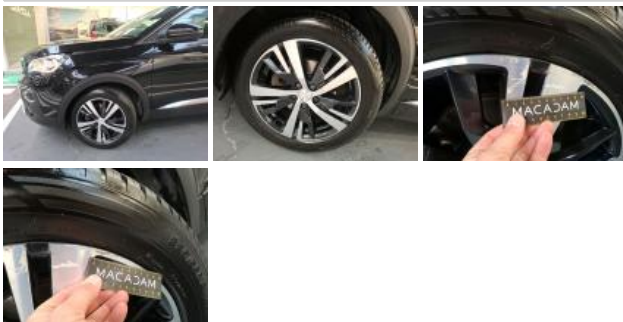

Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Side repeater L, Scratch(es), Replace



Wing RL, Scratch(es), Paint



Central pillar moulding L, Scratch(es), Replace



Bonnet, Stone chip(s), Paint



Bumper grille, Broken, Replace



Bumper spoiler F, Broken, Replace and paint



Bumper moulding FR, Scratch(es), Replace




Windscreen, Stone chip(s), Windscreen repair 2 stonechips



Door trim RR, Deformed / Strained, Replace



Door FR, Scratch(es), Acceptable

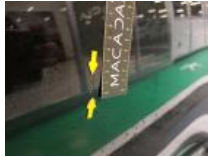

Wing RR, Dent(s), Repair and paint (complete)



Wing FR, Scratch(es), Paint



Bumper R, Deformed / Strained, Replace



Rear bulkhead lining, Scratch(es), Replace



Rear bulkhead lining, Scratch(es), Replace



Rubber seal for boot lid, Tear, Replace



Internal boot lining R, Scratch(es), Replace



Rear roof pillar covering L, Scratch(es), Repair/replace (lump sum)



Internal boot lining L, Scratch(es), Replace

