



Kia Niro: J840KK

Vinnumber:	KNACC81GFL5042900	Versionname:	e-Niro 150kW / 64kWH Executive Line automaat (NEDC)
First Registrationdate:	28/08/2020	Fiscalpower:	
Expertise Mileage:	100885	Power Kw:	150
Bodytype:		Body colour	Aurora Black Pearl
Gearbox:	Automatic	Paint type	Metallic
Transmission:	Front	Type of rims (mounted)	Aluminium
Fueltype:	Electric	Parking lot	829
Number of seats	5		
Type of rims (mounted)	Aluminium		
Maintenance needed	No		

Options

Number of keys total	2	Telephone equipment
GPS		Lining leather
Autom climate control		Central consol F
Windows electric F		Luggage cover
Radio multimedia		Headlights Xenon/LED/Laser
		Front parking sensors
		Rear parking sensors

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	215 / 55 / 17 / 94 / V / Aluminium	7,9 mm	Michelin	Summer
	Right	215 / 55 / 17 / 94 / V / Aluminium	6,3 mm	Michelin	Summer
Rear	Left	215 / 55 / 17 / 94 / V / Aluminium	4,9 mm	Goodyear	Summer
	Right	215 / 55 / 17 / 94 / V / Aluminium	5,9 mm	Goodyear	Summer


Assistance equipment

Number of charging cables (normal)	1
Number of charging cables (rapid charge)	1

Door RL, Scratch(es), Repair and paint (complete)




Wheel arch cover RL, Scratch(es), Replace

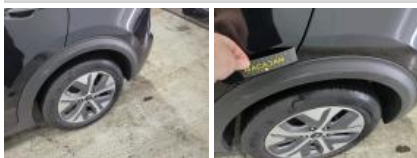

Wing RL, Scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)

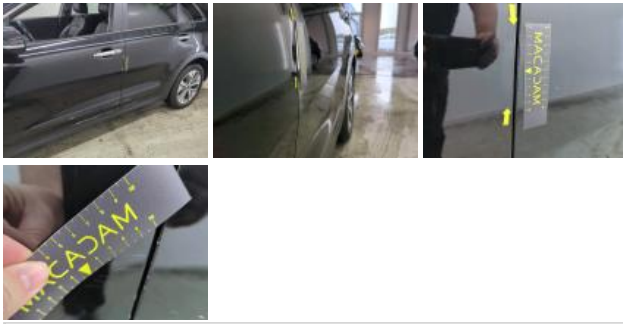

Bonnet, Scratch(es), Repair and paint (complete)



Bumper F, Scratch(es), Repair and paint (complete)




Door trim RR, Scratch(es), Replace



Wheel arch cover RR, Scratch(es), Replace



Door RR, Scratch(es), Repair and paint (complete)

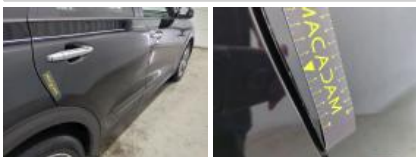

Wing RR, Scratch(es), Repair and paint (complete)



Wing FR, Scratch(es), Repair and paint (complete)



Boot lid covering R, Scratch(es), Replace



Bumper moulding RL, Scratch(es), Replace



Bumper R, Scratch(es), Repair and paint (complete)



Tailgate / Boot, Scratch(es), Repair and paint (complete)



Roof, Scratch(es), Repair and paint (complete)

