



Ford Focus

1.5 EcoBlue Titanium Business 120 Auto SW



VIN NO WF0PXXGCHPNL30857
Registration Number DG73379

MOT Date

2026-03-23

Last Service



Number of Owners

1

Last Service Mileage



Number of Keys

2

First Registration Date

2022-03-29

Odometer Reading

126012 km

Country First Registered

Denmark

Inspection Report Summary

Customer	BCA Vejle	Mechanical Grade	A
Inspection Date / Place	2026-04-16 / Auktionsvej 8 Vers. 2	Cosmetic Grade	3


Vehicle Summary




Vehicle Condition	Runner	VAT Type	Qualifying Net
Fuel Type	Diesel	Gearbox Type	Automatic
Colour	Blue	Engine Size (cc)	1499
Engine Size	1.5	No of Doors	5
Body Type	Van	Drive Train	Front
Charging Cables		No of Seats	2
WLTP CO2 Emissions	123	Seat Covering	
First Registration / Construction Year	2022-03-29 / 2022-03-29	Arrival Date	2026-04-14
Service History	Present		

Vehicle History & Documents

Service Book Available	Present	Previous Usage	
Next Service Mileage	km	Imported	No



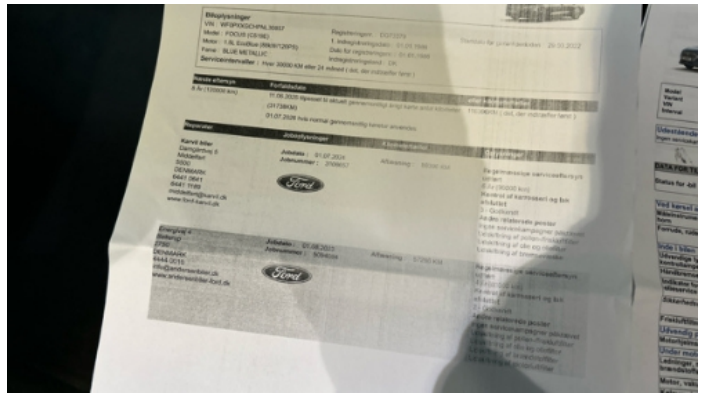

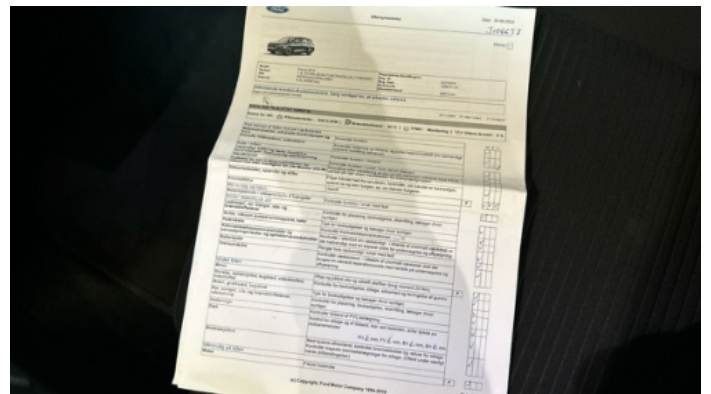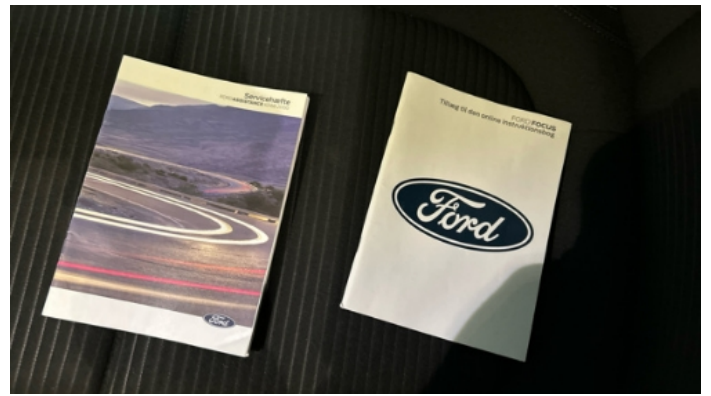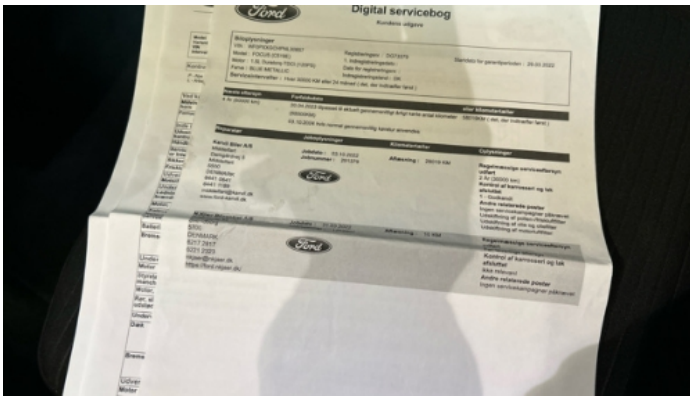



Equipment

Rear parking sensors

Satellite navigation

Cruise control

Reversing Camera

Front parking sensors

Wheels & Tyres

Mounted Tires

Tyre / Wheel Type

//R / 5 mm


//R / 4 mm

//R / 5 mm


//R / 5 mm

Cosmetic Damage


8 identified damages

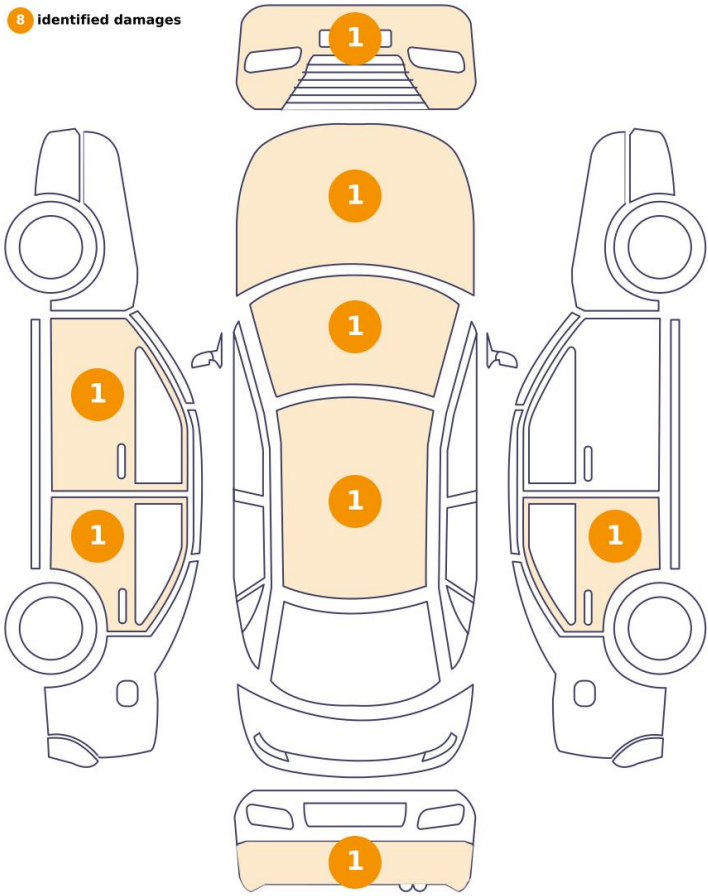

1 identified damages

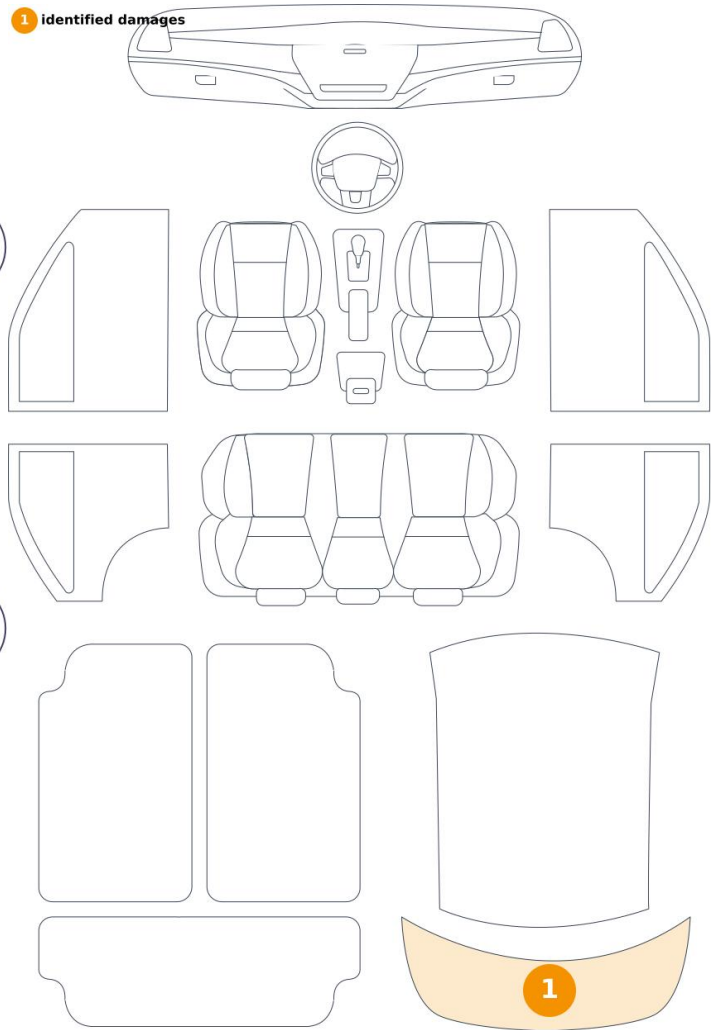


Component	Damage	Comments
1 Hood	Paint / Stone Chip	
2 Tailgate Upholstery / Back	Interior / Scratched	
3 Windshield / Front	Paint / Chipping	
4 Bumper / Front	Paint / Scratch / Scuff	
5 Bumper / Back	Paint / Scratch / Scuff	
6 Door / Back Right	Bodywork / Dent / Dent	
7 Door / Back Left	Bodywork / Dent / Dent	
8 Roof	Bodywork / Dent / Dent	
9 Door / Front Left	Bodywork / Dent / Dent	

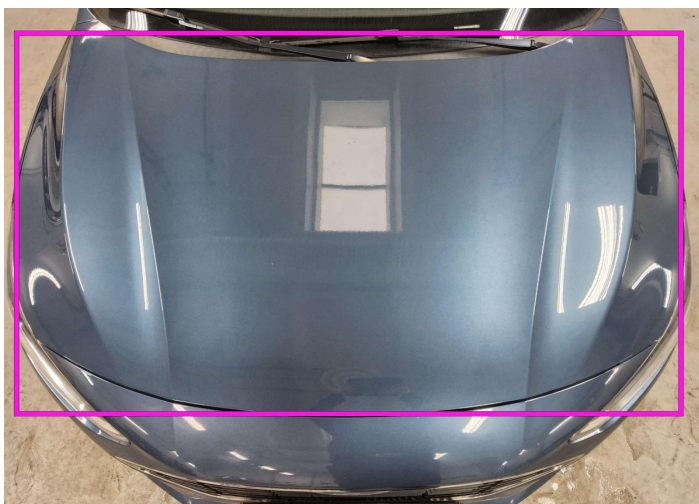

1. Hood
Paint / Stone Chip -



2. Tailgate Upholstery / Back
Interior / Scratched -

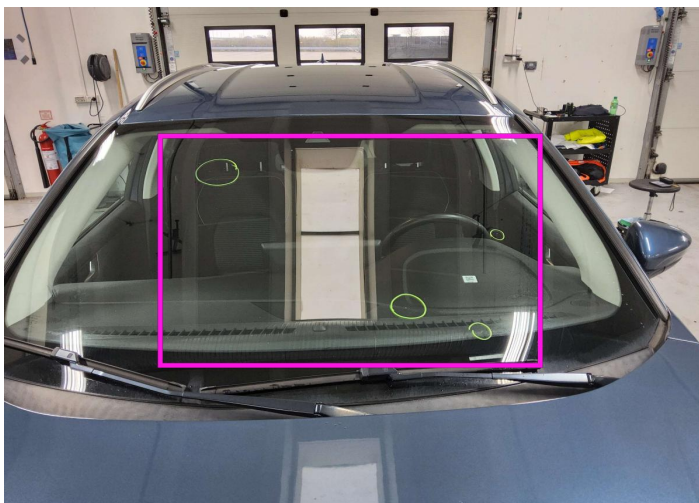


3. Windshield / Front
Paint / Chipping -




4. Bumper / Front
Paint / Scratch / Scuff -




5. Bumper / Back
Paint / Scratch / Scuff -

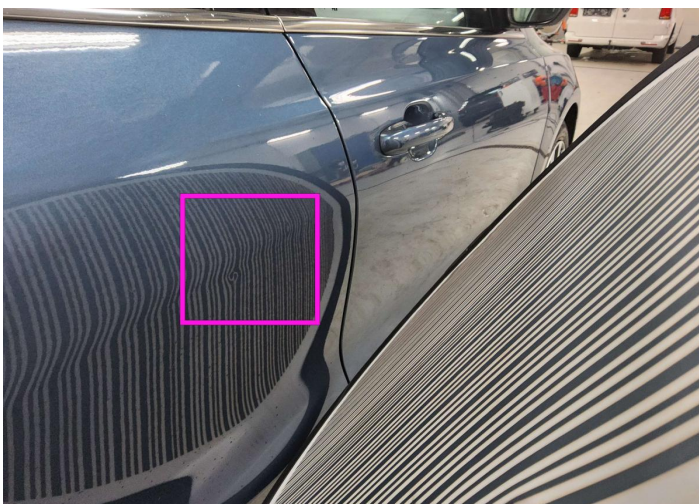


6. Door / Back Right
Bodywork / Dent / Dent -

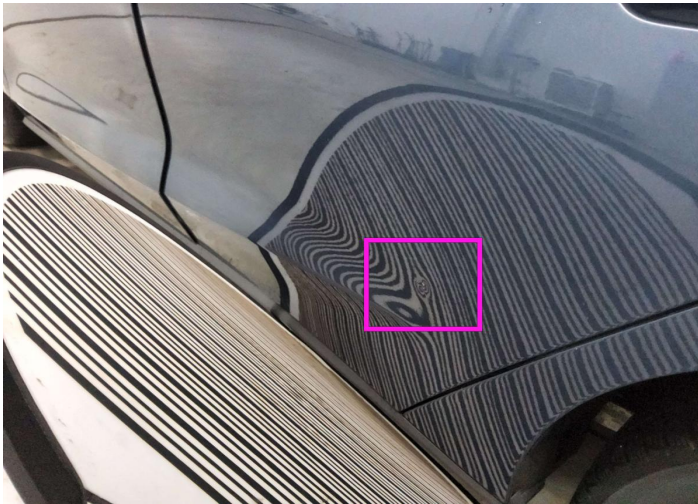

7. Door / Back Left
Bodywork / Dent / Dent -

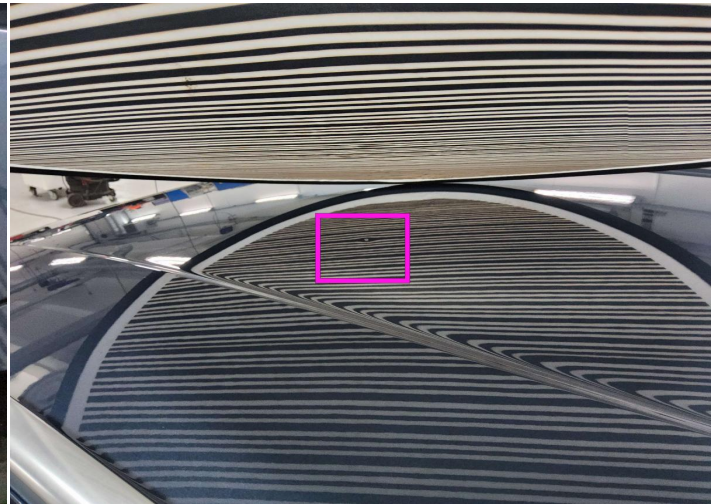

8. Roof
Bodywork / Dent / Dent -

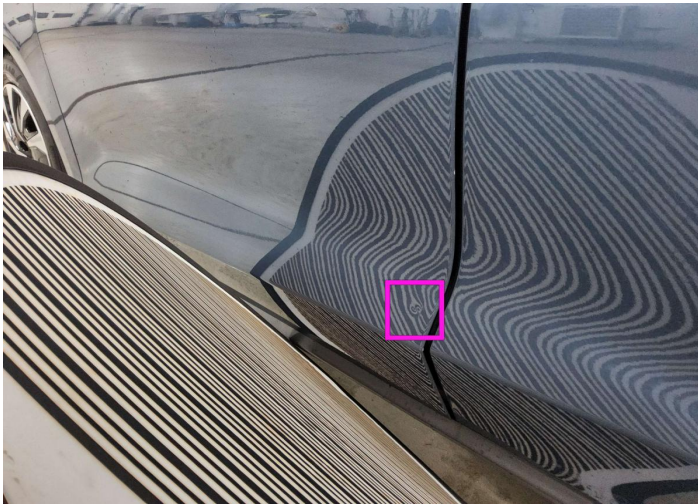

9. Door / Front Left
Bodywork / Dent / Dent -

Mechanical Condition

Control Lights

Engine Yellow Lamp Lights Up	✓	No Dashboard Lights	✓
Engine Management Warning Light	✓	Oil Pressure Warning Light	✓
Airbag Warning Light	✓	Brake Warning Light	✓
ABS Warning Light	✓	Power Steering Warning Light	✓
Transmission Warning Light	✓	Diesel Particulate Warning Light	✓
ESP Fault/Traction Control Malfunction Light	✓	Battery Charge Warning Light	✓
4WD Light	✓	Service Light	✓
Display Defect	✓		

Engine

Engine Functioning	✓	Vehicle Start - up	✓
--------------------	---	--------------------	---

Other Checks

Clutch Functioning	NA	Steering Functioning	✓
--------------------	----	----------------------	---

Equipments Test

Audio Equipment	✓	Electric Windows	✓
AC/Heating System	✓	Parking Sensors/Cameras Functioning	✓
Navigation Equipment	✓	Central Locking TD	✓

Test Drive Inspection

Other Checks

Steering Noise	✓	Brake System Functioning	✓
Gears Functioning	✓		

Engine

Power Loss	✓	Excessive Fume Quantity/Colour	✓
Engine Noise	✓		

✓ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*

! *Damages or malfunction detected that requires repairs by the buyer*

NA *Not applicable*

— *Not tested*