



# PEUGEOT 5008

## 5008 BlueHDi 130ch S&S EAT8 Allure

VIN NO VF3MCYHZRJL095622

Registration Number FC465VM



MOT Date



Last Service

2026-01-08

Number of Owners



Last Service Mileage

224283

Number of Keys



First Registration Date

2018-12-27

Odometer Reading

225535 km

Country First Registered



### Inspection Report Summary

Customer	BCAuto Encheres	Mechanical Grade	
Inspection Date / Place	2026-02-27 / BCA MITRY	Cosmetic Grade	3

### Vehicle Summary

Vehicle Condition	Runner	VAT Type	Qualified - Normal Rate
Fuel Type	Diesel	Gearbox Type	Automatic
Colour	White	Engine Size (cc)	1499
Engine Size	1.5	No of Doors	5
Body Type	MPV	Drive Train	Front
Charging Cables		No of Seats	7
NEDC CO2 Rating (q/km)	102	Seat Covering	
Engine Rating CV	6	Metalic Colour	
Accident Damage	No	Euro Emission	
First Registration / Construction Year	2018-12-27 / 1900-01-01	Arrival Date	2026-02-26
Service History	224283		

### Vehicle History & Documents

Service Book Available	Missing	Previous Usage	Normal Use
Manufacturer Warrenty		Odometer Warranty	No
Next Service Mileage	km	Imported	No





## Equipment

---

Central locking	Rear parking sensors	Electric Tailgate	Cruise control
Front parking sensors	Satellite navigation	Radio	Alloys wheels
Stability control	Front fog lamps	Power assisted steering	

## Equipment Details

---

Presence Anti-Theft Lock Nut	Ok	Air Conditioning	Yes
Seat Heating	No	Sunroof Type	Tilt/Slide Steel


## Wheels & Tyres

---


Left Rear Tyre Depth	4	Left Front Tyre Depth	4
Right Rear Tyre Depth	4	Right Front Tyre Depth	4

## Cosmetic Damage

23 Identified damages

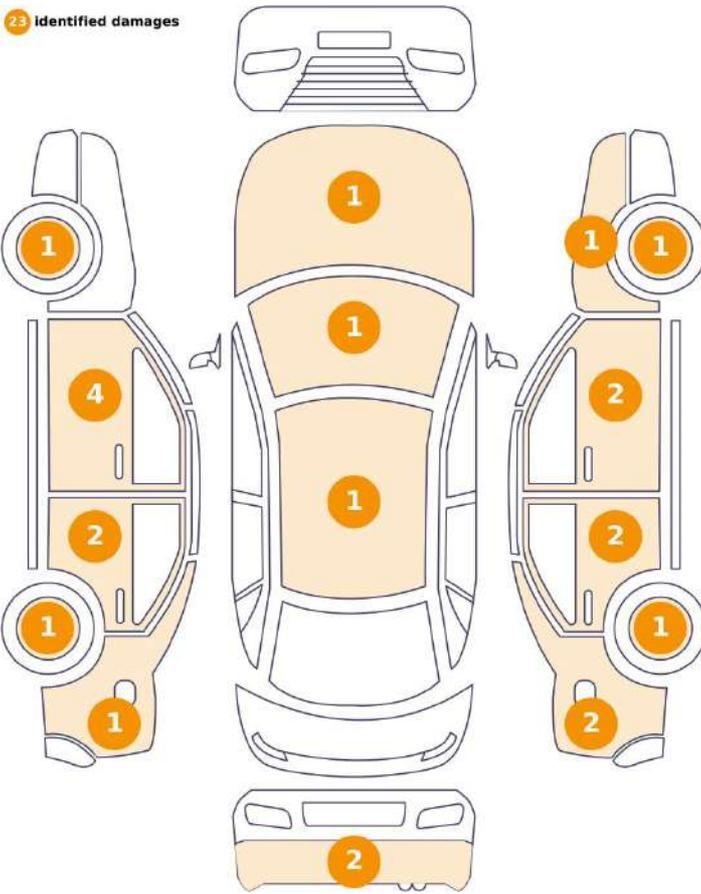

6 Identified damages

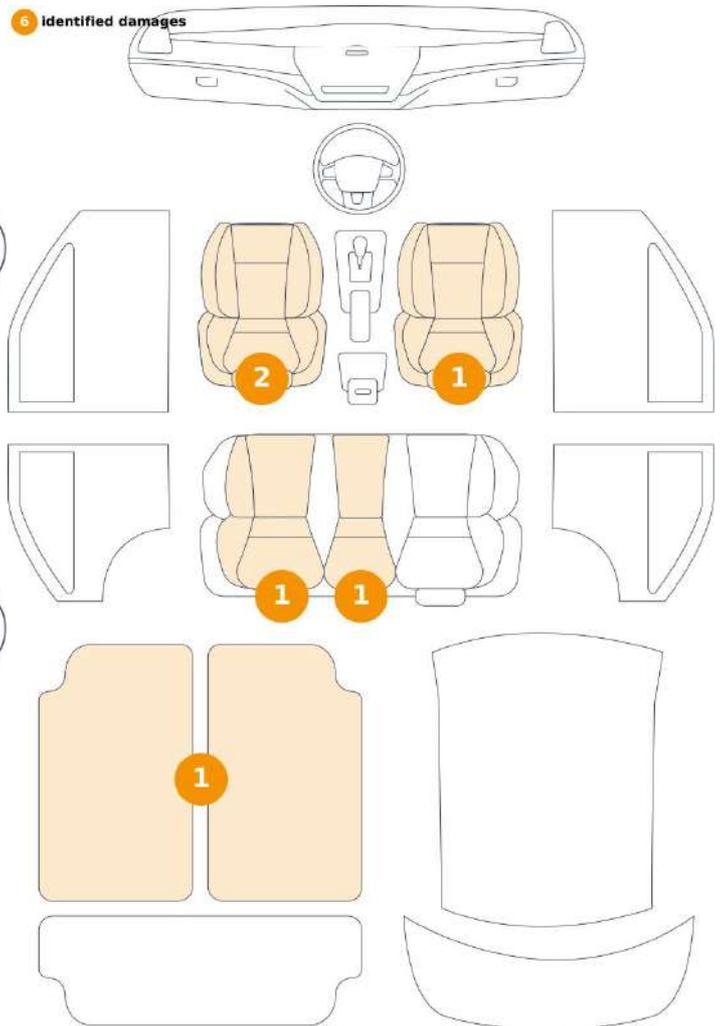

Component	Damage	Comments
1 Rim / Back Right	Out of Bodywork / Scratch	
2 Rim / Front Right	Out of Bodywork / Scratch	
3 Rim / Back Left	Out of Bodywork / Scratch	
4 Hood	Paint / Scratch / Line	
5 Roof	Paint / Scratch / Line	
6 Seat / Front Right	Interior / Dirty	
7 Door / Back Right	Paint / Scratch / Line	
8 Seat / Back Left	Interior / Dirty	
9 Seat / Back Center	Interior / Dirty	
10 Side Panel / Back Right	Paint / Scratch / Line	
11 Seat / Front Left	Interior / Dirty	

12	Side Panel / Back Left	Paint / Scratch / Line
13	Door / Front Left	Bodywork / Dent / Hail Area
14	Corner Bumper / Back Right	Paint / Scratch / Line
15	Door / Front Left	Paint / Scratch / Line
16	Door / Back Right	Bodywork / Dent / Deformation
17	Door / Front Right	Paint / Scratch / Line
18	Side Panel / Back Right	Paint / Scratch / Line
19	Door / Back Left	Paint / Scratch / Line
20	Door / Back Left	Paint / Scratch / Line
21	Door / Front Left	Paint / Scratch / Line
22	Floor Carpet	Interior / Ripped
23	Rim / Front Left	Out of Bodywork / Scratch
24	Bumper / Back	Bodywork / Dent / Deformation
25	Seat / Front Left	Interior / Ripped
26	Fender / Front Right	Paint / Scratch / Line
27	Windshield / Front	Paint / Chipping
28	Door / Front Right	Paint / Scratch / Line
29	Door / Front Left	Paint / Scratch / Line



1. Rim / Back Right  
Out of Bodywork / Scratch -



2. Rim / Front Right  
Out of Bodywork / Scratch -



3. Rim / Back Left  
Out of Bodywork / Scratch -




4. Hood  
Paint / Scratch / Line -



5. Roof  
Paint / Scratch / Line -




6. Seat / Front Right  
Interior / Dirty -

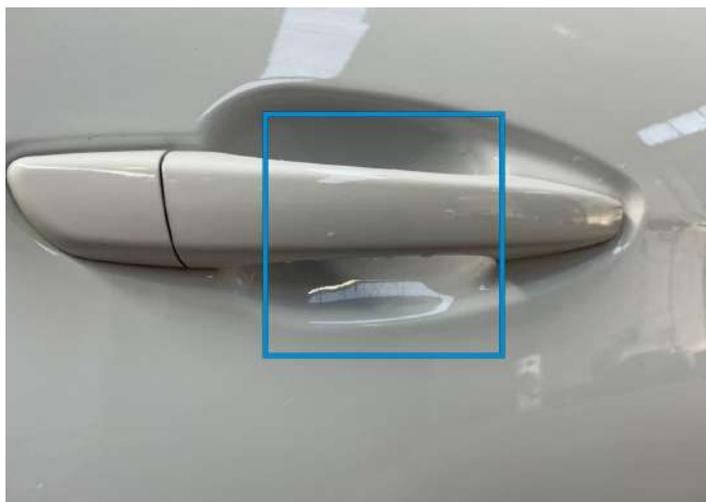


7. Door / Back Right  
Paint / Scratch / Line -



8. Seat / Back Left  
Interior / Dirty -

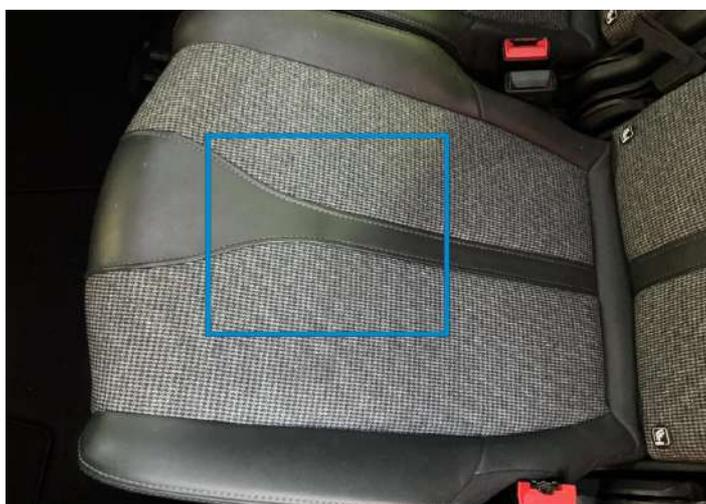


9. Seat / Back Center  
Interior / Dirty -

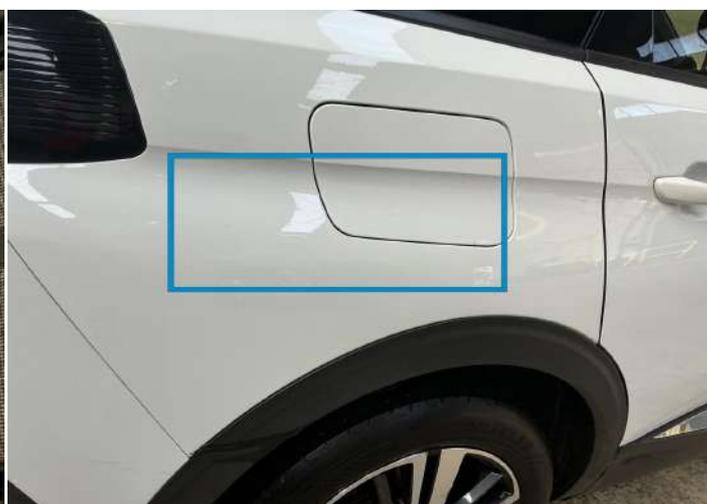

10. Side Panel / Back Right  
Paint / Scratch / Line -



11. Seat / Front Left  
Interior / Dirty -

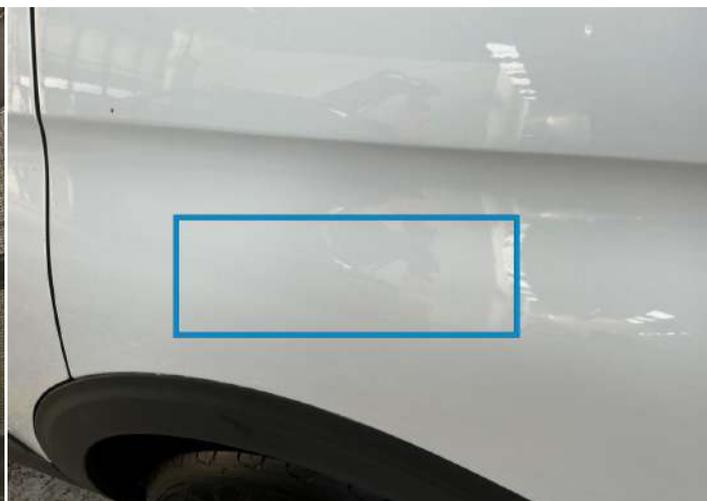

12. Side Panel / Back Left  
Paint / Scratch / Line -



13. Door / Front Left  
Bodywork / Dent / Hail Area -



14. Corner Bumper / Back Right  
Paint / Scratch / Line -



15. Door / Front Left  
Paint / Scratch / Line -



16. Door / Back Right  
Bodywork / Dent / Deformation -



17. Door / Front Right  
Paint / Scratch / Line -



18. Side Panel / Back Right  
Paint / Scratch / Line -




19. Door / Back Left  
Paint / Scratch / Line -



20. Door / Back Left  
Paint / Scratch / Line -



21. Door / Front Left  
Paint / Scratch / Line -

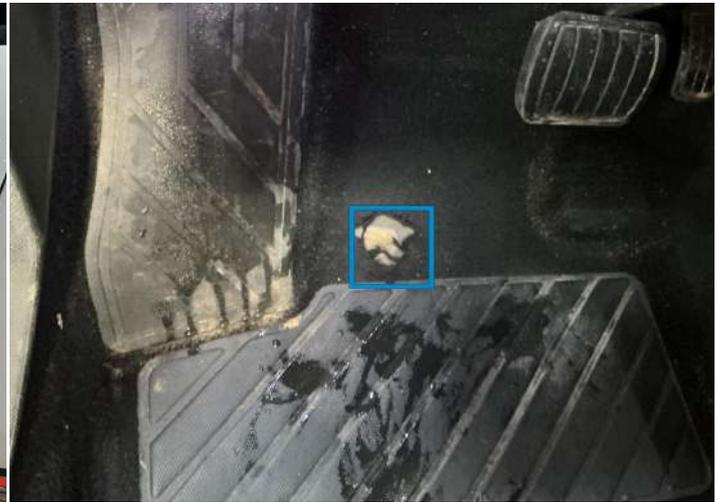

22. Floor Carpet  
Interior / Ripped -



23. Rim / Front Left  
Out of Bodywork / Scratch -



24. Bumper / Back  
Bodywork / Dent / Deformation -



25. Seat / Front Left  
Interior / Ripped -



26. Fender / Front Right  
Paint / Scratch / Line -



27. Windshield / Front  
Paint / Chipping -



28. Door / Front Right  
Paint / Scratch / Line -



29. Door / Front Left  
Paint / Scratch / Line -

## Mechanical Condition

Levels			
Oil Condition	✓	Level - Oil	✓
Coolant Fluid - Condition	✓	Coolant Fluid level	✓
Brakes Fluid	✓		
Dashboard Lights			
ABS Warning Light	✓	Transmission Warning Light	✓
Diesel Particulate Filter Light	✓	ESP Fault/Traction Control Malfunction Light	✓
4WD Light	NA	Service Light	✓
Dashboard Working	✓	Engine Light	✓
Oil Pressure Warning Light	✓	Airbag Warning Light	✓
Brake Warning Light	✓	Steering Fluid Level	NA
Level - Fuel / Battery	70		
Equipments Test			
Main & Spare Keys Functioning	✓	Parking Sensors / Cameras Functioning	✓
Convertible, Sunroof, Wagon, Flatbed truck, Tailgate electrics test	✓	Dump / Trail / Tail Gate Lift	NA
Electric Windows	✓	Audio Equipment	✓
Navigation System	✓	AC / Heating System	✓
Central Locking	✓		
Engine			
Cross Member	✓	Serpentine Belt	✓
Control Liquid Leak	!		
Hybrid/EV			
Charge Port Condition	NA	Charge lead 1 condition /Charge lead 2 condition	NA
Hybrid System Fault	NA		

## Test Drive Inspection

---

### Test Drive

Engine functioning	✓	Engine / Aux Belt / Pulley Noise	✓
Steering Noise/Gripping	✓	Vehicle Starts	✓
Engine Power	✓	Smoke Quantity	✓
Transmission	✓	Clutch Functioning	NA
Brakes Functioning	✓	Steering	✓

✓ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*

! *Damages or malfunction detected that requires repairs by the buyer*

NA *Not applicable*

☐ *Not tested*

### Disclaimer Section

---

*The test drive is done on a flat surface and lasts about 2 minutes. The driven distance is a minimum of 300 meters, including a u-turn, an acceleration and a braking phase. The highest speed achieved during this test is 50km/h. The mechanical check is a visual and dynamic diagnosis without any disassembly. We cannot guarantee any mechanical wear part.*