



**Peugeot 2008 (UKL): 2BHV605**

Vinnnumber:	<b>VR3UDYHZSMJ906893</b>	Versionname:	<b>2008 Allure 1.5 BlueHDi S&amp;S 130pk/cv 5p EAT8</b>
First Registrationdate:	<b>1/12/2021</b>	Fiscalpower:	
Expertise Mileage:	<b>133902</b>	Power Kw:	<b>96</b>
Bodytype:		Type of rims (mounted)	<b>Aluminium</b>
Gearbox:	<b>Automatic</b>		
Transmission:			
Fueltype:			
Maintenance	<b>OK</b>		
Maintenance	<b>plus 2800 km</b>		
Battery functioning	<b>Yes</b>		
Type of rims (mounted)	<b>Aluminium</b>		
Certificate of Conformity	<b>Yes</b>		
Category	<b>Passenger Car</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Number of keys total	<b>2</b>	Luggage cover	
GPS		Type of Tow bar	<b>No Tow bar</b>
Type of Maintenance book	<b>Digital maintenance</b>		
Type of GPS storage	<b>HD</b>		

**Tyres**

<b>215/60/17/100 V</b>				
Summer tyres:	Fr.L.	<b>Firestone: 2 mm</b>	Fr.R.	<b>Firestone: 2 mm</b>
	Re.L.	<b>Michelin: 3 mm</b>	Re.R.	<b>Michelin: 5 mm</b>
Tyre profile depth FL				<b>2.0</b>
Tyre profile depth FR				<b>2.0</b>
Tyre profile depth RL				<b>3.0</b>
Tyre profile depth RR				<b>5.0</b>
Tyre size FL				<b>215/60 R 17 100 V</b>
Tyre size FR				<b>215/60 R 17 100 V</b>
Tyre size RL				<b>215/60 R 17 96 H</b>
Tyre size RR				<b>215/60 R 17 96 H</b>
Tyre type FL				<b>Summer</b>
Tyre type FR				<b>Summer</b>
Tyre type RL				<b>Summer</b>
Tyre type RR				<b>Summer</b>
Tyre make FL				<b>258</b>
Tyre make FR				<b>258</b>
Tyre make RL				<b>261</b>
Tyre make RR				<b>261</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

**Interior, Dirty, Cleaning**





Door panel FR, Scratch(es), Acceptable



Interior covering A pillar R, Scratch(es), Acceptable



Roof liner, Burned, Smart repair



Interior, Smell, Ozone treatment



Bumper F, Scratch(es), Acceptable



Bumper moulding F, Scratch(es), Acceptable



Bumper moulding F, Scratch(es), Acceptable



Windscreen, Stone chip(s), Replace



Door RL, Scratch(es), Acceptable



Alloy rim RL, Scratch(es), Acceptable



Door FL, Dent(s) and scratch(es), Spot repair




Roof pillar L, Dent(s), Acceptable



Boot lid covering R, Scratch(es), Acceptable



Bumper R, Scratch(es), Smart repair

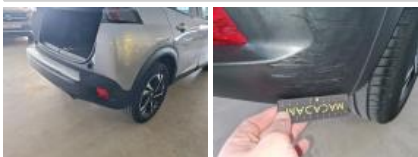

Bumper moulding R, Scratch(es), Acceptable



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing RR, Dent(s), Paintless dent repair



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Outside rear-view mirror base R, Scratch(es), Acceptable



Mirror side repeater R, Broken, Replace

