



RENAULT CLIO: GD-213-EM

Vinnumber:	VF1RJA00667890819	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)
First Registrationdate:	26/11/2021	Fiscalpower:	
Expertise Mileage:	158987	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Headlights Xenon/LED/Laser	
Windows electric F		Rear parking sensors	
Windows electric R		Seat cover lining	Lining Other
Cruise Control			
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres


	195/55/16/91 V			
Summer tyres:	Fr.L.	Dunlop: 90%	Fr.R.	Dunlop: 90%
	Re.L.	Dunlop: 60%	Re.R.	Dunlop: 70%
Tyre profile depth FL				2.0
Tyre profile depth FR				2.0
Tyre profile depth RL				4.2
Tyre profile depth RR				3.8
Tyre size FL				195/55 R 16 91 V
Tyre size FR				195/55 R 16 91 V
Tyre size RL				195/55 R 16 91 V
Tyre size RR				195/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				257
Tyre make FR				257
Tyre make RL				257
Tyre make RR				257

Assistance equipment

Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Stain, Cleaning

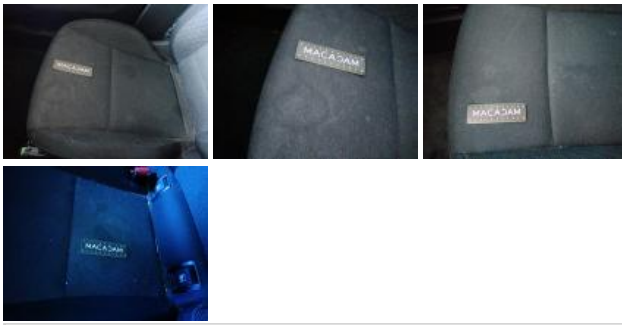


Interior trim, Missing, Replace



Tyre RR, Out of tolerance, Replace




Wheel cover RR, Broken, Replace

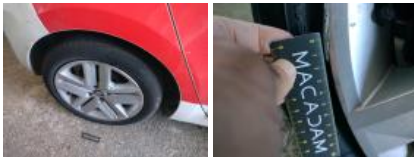


Wheel cover FR, Broken, Replace



Tyre FR, Out of tolerance, Replace

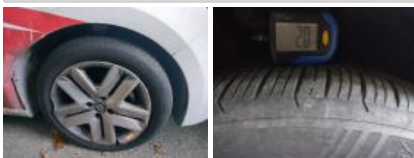

Tyre FL, Out of tolerance, Replace

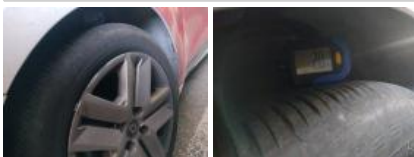

Outside rear-view mirror housing L, Scratch(es), Acceptable



Wing FL, Dent(s), Repair and paint (complete)



Door FL, Dent(s), Repair and paint (complete)



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Dent(s), Repair and paint (complete)



Door RL, Dent(s), Repair and paint (complete)



Bumper F, Scratch(es), Paint



Grille, Unclasp(ed), Dismount/Mount



Bumper grille, Unclasp(ed), Dismount/Mount



Bumper moulding FL, Unclasp(ed), Dismount/Mount



Door RR, Dent(s), Repair and paint (complete)



Wing FR, Dent(s), Replace and paint



Luggage compartment cover, Missing, Replace



Bumper R, Deformed / Strained, Repair and paint (complete)



Bodywork, Not original part, Sticker removal small

