



Inspection Report

Customer	BCA Sweden	Cosmetic Grade	4
Registration Number	YYY40J	Mechanical Grade	B

Vehicle Data

KIA Niro e-Niro Advance - 2021

Vehicle Identification Number	KNACC81GFM5085071	Odometer Reading	161725 km
First Registration / Construction Year	2021-03-09 / 2021-01-01	Inspection Date / Place	2025-06-23 / Strängnäs
Fuel Type	Battery Electric Vehicle	Gearbox Type	Automatic
Colour	White	Number of Keys	2
Service Book Available	Present	Service History	15638, 54120, 75444, 92776, 110950
Last Service Km / Date	110960 / 2024-01-08	Arrival Date	2025-06-03

Mounted Tires

Tyre / Wheel Type	Summer
	//R16 / 2 mm
	//R16 / 3 mm
	//R16 / 7 mm
	//R16 / 5 mm

Unmounted Tires

Tyre / Wheel Type	Studded
	//R17 / 5 mm
	//R17 / 6 mm
	//R17 / 6 mm
	//R17 / 8 mm

Equipment

• Heated steering wheel • Cruise control • Electrically adjustable seats • Rain sensitive windscreen wipers • Reversing Camera • Front parking sensors	• Bluetooth • Digital Radio • LED Headlamps • Rear parking sensors • Satellite navigation
---	---

Comments Test Drive

Comment Reverse camera malfunction/ backkamera ur funktion

Checklist


Chipped	Front Noise
Stickers	Testdriven

Damage

Component	Damage
1 Floor Carpet	Interior / Holed
2 Floor Carpet	Interior / Holed
3 Roof Upholstery	Interior / Missing
4 Other	Interior / Holed
5 Trunk Carpet	Interior / Holed
6 Luggage Space Cover / Back	Interior / Missing
7 Steering Wheel / Front	Interior / Scratched
8 Dashboard / Front	Interior / Broken
9 Floor Carpet	Interior / Stained
10 Roof Upholstery	Interior / Missing
11 Digital Combined Instrument Panel	Interior / Broken
12 Tire / Front Right	Tire
13 Door / Back Left	Bodywork / Dent / Deformation
14 Rim / Back Left	Out of Bodywork / Scratch
15 Tire / Front Left	Tire
16 Shield / Back	Paint / Scratch / Scuff
17 Pillar / Front Right	Bodywork / Dent / Dent
18 Fender / Front Right	Bodywork / Dent / Dent
19 Shield / Front	Bodywork / Breakage
20 EV charging port	Bodywork / Breakage
21 Hood	Bodywork / Dent / Dent
22 Roof	Paint / Chemical Damage
23 Windshield / Front	Glass Break / Impact
24 Windshield Joint / Front	Paint / Chemical Damage
25 Missed Service	


Photo Documentation



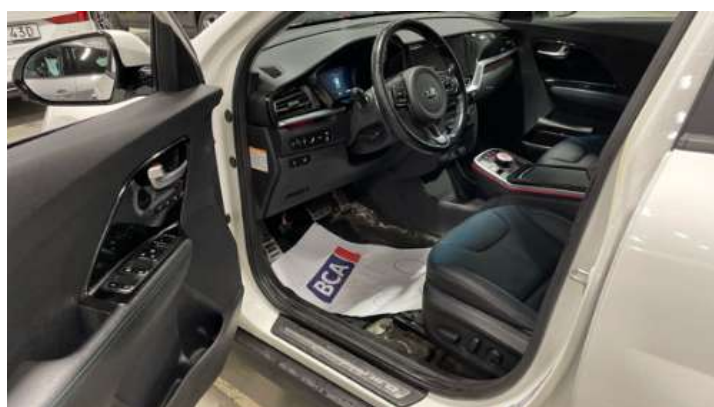





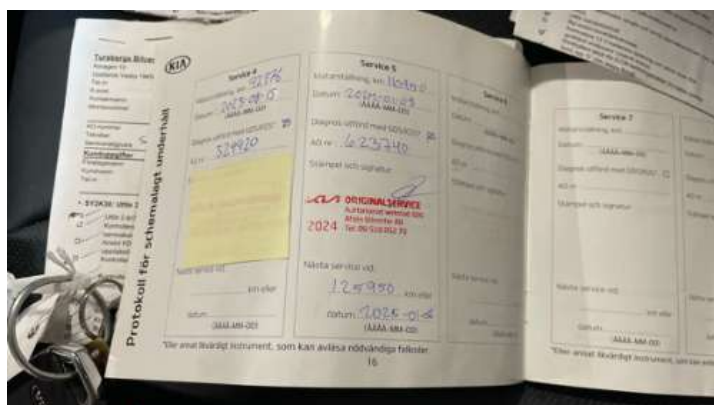



1. Floor Carpet
Interior / Holed



2. Floor Carpet

Interior / Holed



3. Roof Upholstery

Interior / Missing

Left roof handle is missing. Vänster handtag i taket saknas.



4.

Interior / Holed




5. Trunk Carpet
Interior / Holed



6. Luggage Space Cover / Back
Interior / Missing



7. Steering Wheel / Front
Interior / Scratched

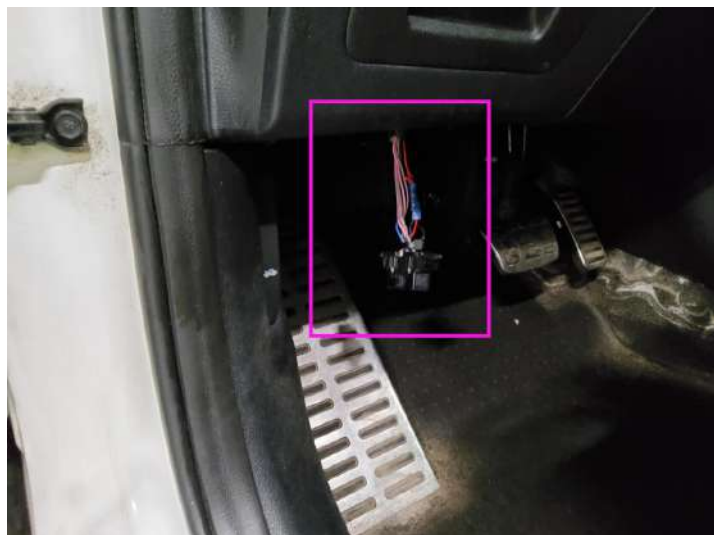

8. Dashboard / Front

Interior / Broken

OBD malfunction. OBD ur funktion.



9. Floor Carpet

Interior / Stained



10. Roof Upholstery

Interior / Missing

Right roof handle is missing. Höger handtag i taket saknas.



11. Digital Combined Instrument Panel


Interior / Broken

Rear camera malfunction. Backkamera ur funktion.



12. Tire / Front Right

Tire

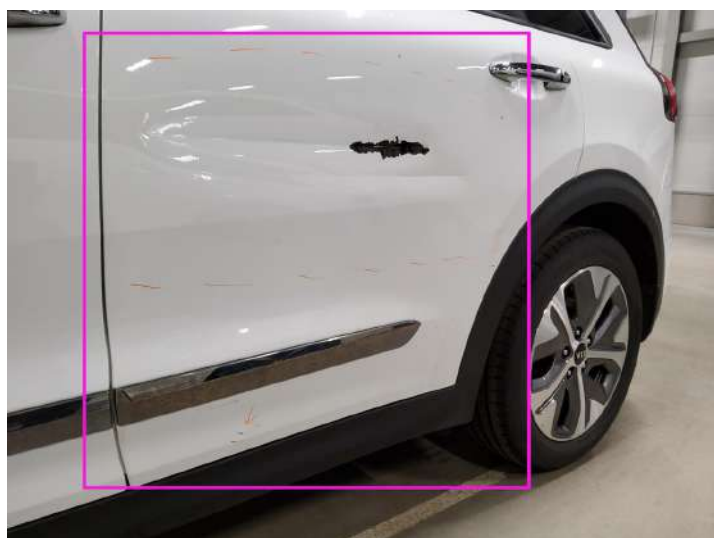

13. Door / Back Left

Bodywork / Dent / Deformation



14. Rim / Back Left

Out of Bodywork / Scratch




15. Tire / Front Left

Tire



16. Shield / Back

Paint / Scratch / Scuff

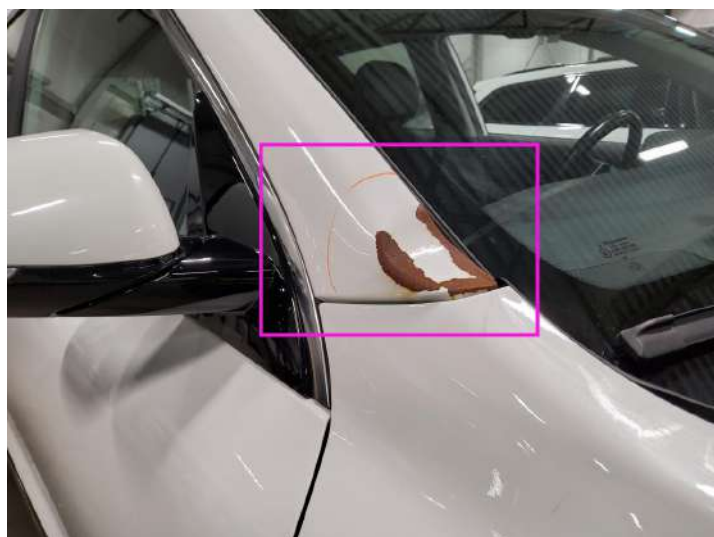

17. Pillar / Front Right

Bodywork / Dent / Dent



18. Fender / Front Right

Bodywork / Dent / Dent



19. Shield / Front

Bodywork / Breakage



20. EV charging port

Bodywork / Breakage



21. Hood

Bodywork / Dent / Dent




22. Roof

Paint / Chemical Damage



23. Windshield / Front
Glass Break / Impact

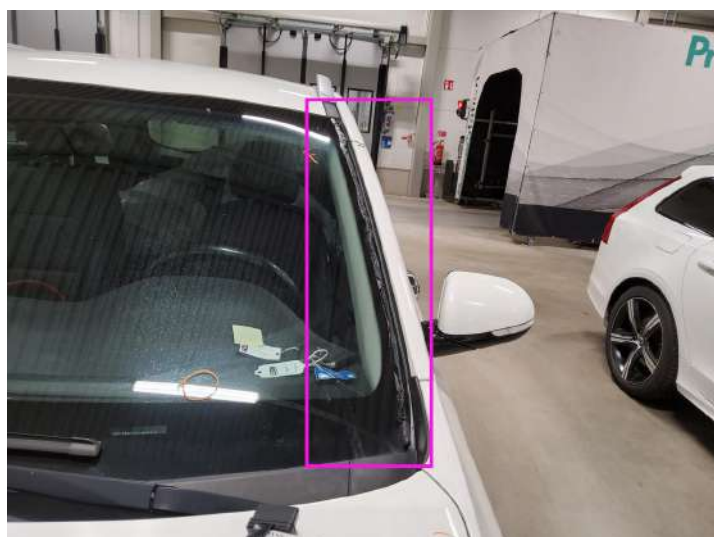

24. Windshield Joint / Front
Paint / Chemical Damage