

INSPECTION REPORT

End of contract


GENERAL INFO

File	316603
License plate	KU5394
Vehicle identification number	VR3EFYHT2MN549607
Dossier	2021235001
Make	Peugeot Partner HDi102 L1 STD
Mileage	192718
First registration	25/11/2021
client availability date	30/06/2026
inspectionDate	03/07/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		N	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		Y	
Towbar (+keys)		N	
Certificate of conformity		N	
Registration certificate		N	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	



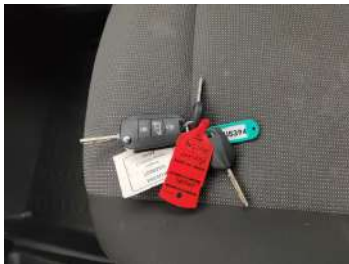

DAMAGES

Damages	Type	Acceptable
13	Bumper Front // Painting	N
19	Bumper Front / Lower Cover Not Painted / Replace	N
54	Headlight / Front left / Replace	N
138	Bumper Rear / Lower Cover Not Painted / Replace	N
149	Back Side / Park Assist Sensor / Replace	N
258	Towing Cover Rear // Replace	N
281	Bumper Rear / Trim Left / Replace	N
41	Windshield // Replace	N
66	Wing Front Left // Polish	Y
72	Side View Mirror Left // Painting	Y
80	Door Front Left // Smart Repair Small	Y
87	Door Front Left / Trim / Replace	Y
114	Wing Rear Left // Repair & Painting	N
124	Light / Rear left / Replace	N
174	Light / Rear Right / Replace	N
184	Wing Rear Right // Repair & Painting	N
197	Door Rear Right / Trim / Replace	Y
201	Rocker Panel Right // Smart Repair Medium	Y
222	Side View Mirror Right // Painting	N
223	Side View Mirror Right // Replace Not Painted	Y
294	Rear Loading Door Left // Repair & Painting	Y
304	Rear Loading Door Right // Repair & Painting	Y
315	Wheel Front Left / Hub Cover With Logo / Replace	N
323	Wheel Steel Rear Left // Replace	N
325	Wheel Rear Left / Hub Cover With Logo // Replace	N
335	Wheel Rear Right / Hub Cover with Logo / Replace	N
345	Wheel Front Right / Hub Cover with Logo / Replacement	N
412	Seat Front Left / Bottom Coating / Replace	N
532	Trunk Compartment / Side Cover Left / Replace	Y
533	Trunk Compartment / Side Cover Right / Replace	Y

569	Dashboard / Steering Wheel / Replace	Y
614	Front Left Door Interior Coating // Replace Completely	Y
624	Front Right Door Interior Coating // Replace Completely	Y
860	Interior Cleaning // Small	N

Damage Pictures



Wheel Rear Left / Hub Cover With Logo // Replace-missing



Wheel Front Right / Hub Cover with Logo / Replacement-missing




Interior Cleaning // Small-stain



Seat Front Left / Bottom Coating / Replace-worn



Dashboard / Steering Wheel / Replace-worn

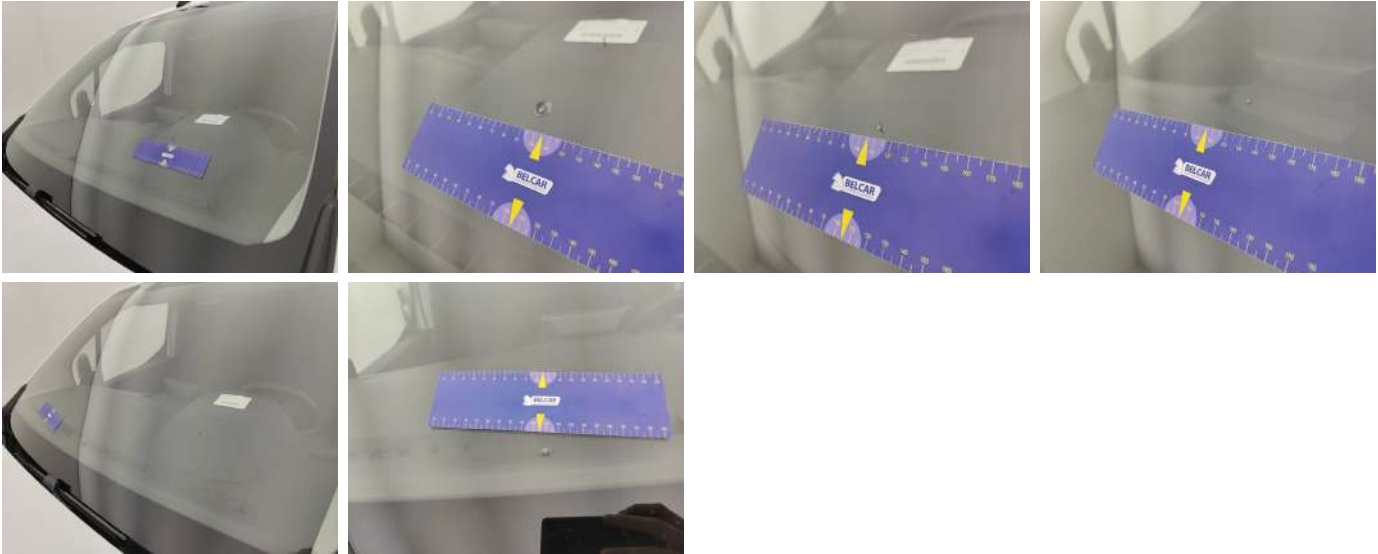


Windshield // Replace-glass damage



Wheel Front Left / Hub Cover With Logo / Replace-missing




Wheel Rear Right / Hub Cover with Logo / Replace-missing

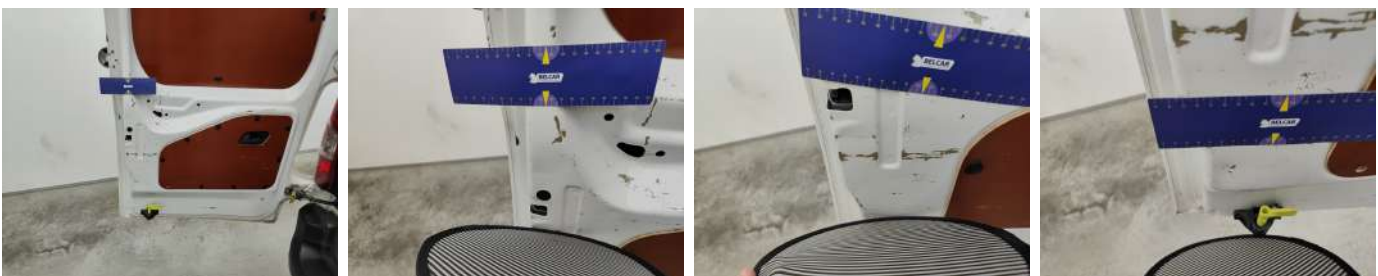



Rear Loading Door Left // Repair & Painting-scratch + dent

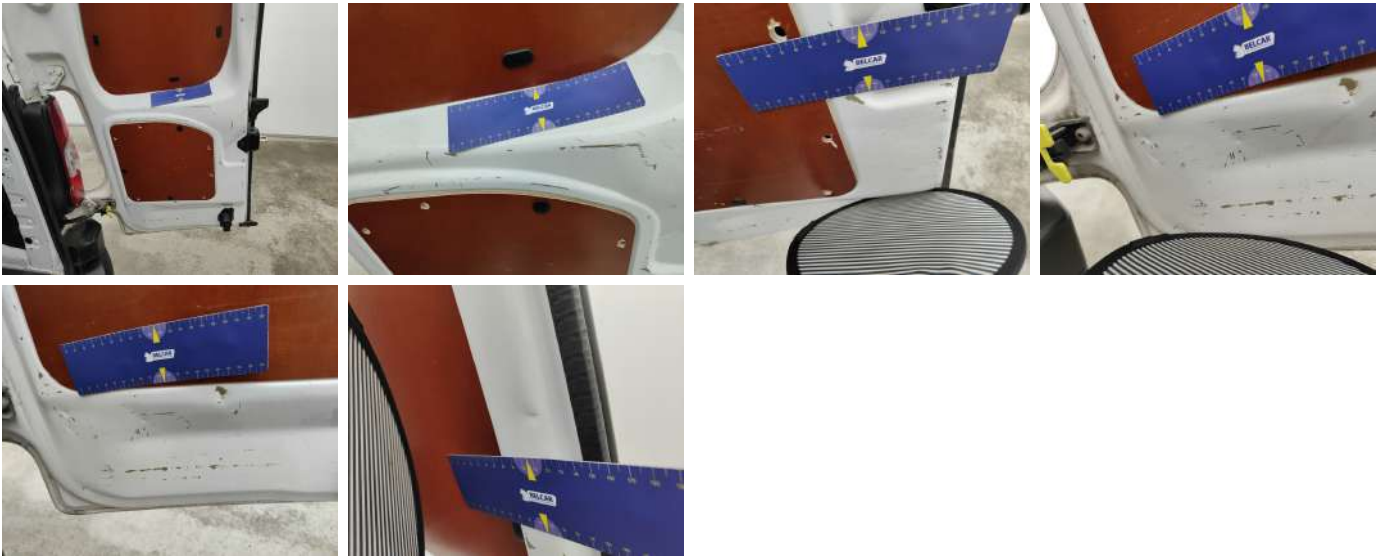

Rear Loading Door Right // Repair & Painting-scratch + dent



Light / Rear Right / Replace-cracked



Light / Rear left / Replace-scratch



Trunk Compartment / Side Cover Left / Replace-scratch



Trunk Compartment / Side Cover Right / Replace-scratch



Door Rear Right / Trim / Replace-scratch



Side View Mirror Left // Painting-scratch



Wing Front Left // Polish-scratch



Door Front Left / Trim / Replace-scratch



Door Front Left // Smart Repair Small-scratch



Side View Mirror Right // Replace Not Painted-scratch



Side View Mirror Right // Painting-scratch



Front Right Door Interior Coating // Replace Completely-scratch



Front Left Door Interior Coating // Replace Completely-scratch



Wheel Steel Rear Left // Replace-dent



Wing Rear Left // Repair & Painting-scratch + dent



Rocker Panel Right // Smart Repair Medium-scratch + dent



Wing Rear Right // Repair & Painting-scratch + dent



Bumper Front / Lower Cover Not Painted / Replace-scratch



Bumper Front // Painting-scratch



Headlight / Front left / Replace-scratch



Bumper Rear / Trim Left / Replace-scratch + dent



Bumper Rear / Lower Cover Not Painted / Replace-cracked



Towing Cover Rear // Replace-missing



Back Side / Park Assist Sensor / Replace-bad position